
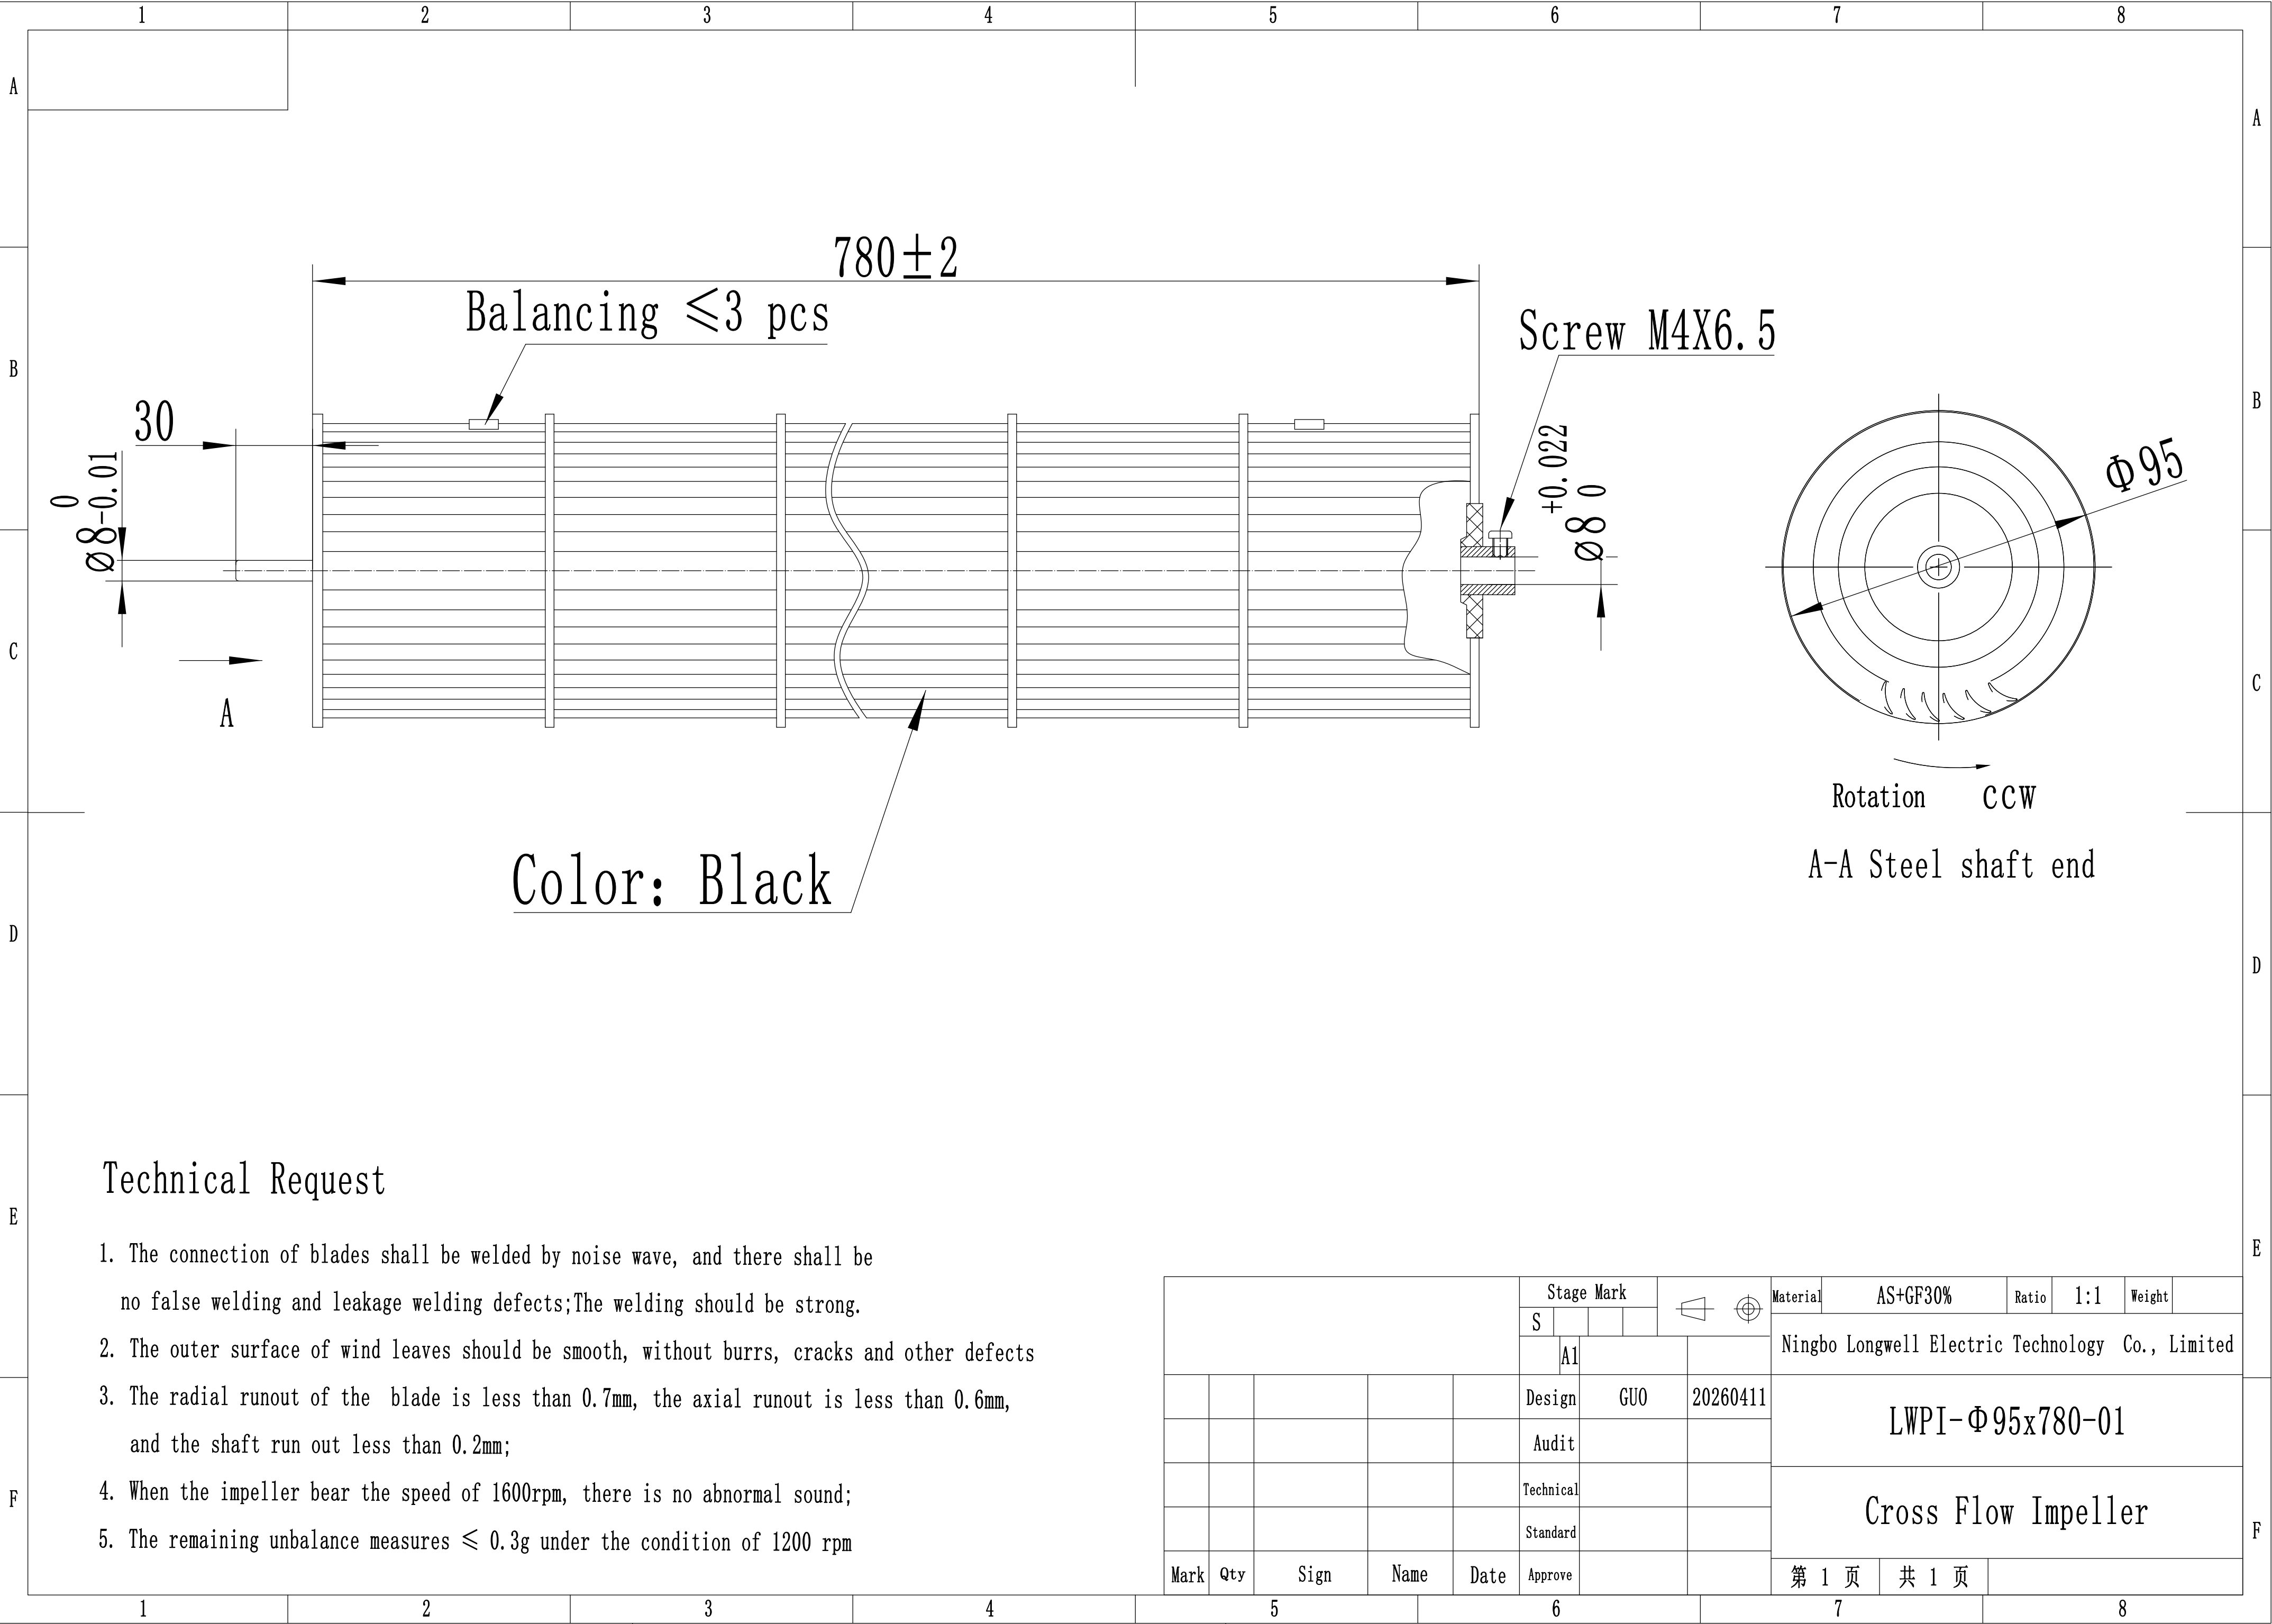




Technical Request

- 1. The connection of blades shall be welded by noise wave, and there shall be no false welding and leakage welding defects;The welding should be strong.
- 2. The outer surface of wind leaves should be smooth, without burrs, cracks and other defects
- 3. The radial runout of the blade is less than 0.7mm, the axial runout is less than 0.6mm, and the shaft run out less than 0.2mm;
- 4. When the impeller bear the speed of 1600rpm, there is no abnormal sound;
- 5. The remaining unbalance measures $\leq 0.3g$ under the condition of 1200 rpm

					Stage Mark			Material	AS+GF30%	Ratio	1:1	Weight	
					S				Ningbo Longwell Electric Technology Co., Limited				
						A1							
					Design	GUO	20260411	LWPI-Φ95x780-01					
					Audit								
					Technical								
					Standard			Cross Flow Impeller					
Mark	Qty	Sign	Name	Date	Approve								
								第 1 页	共 1 页				